




DOMESTIC HOT WATER -Follow operational sequence - (continue)

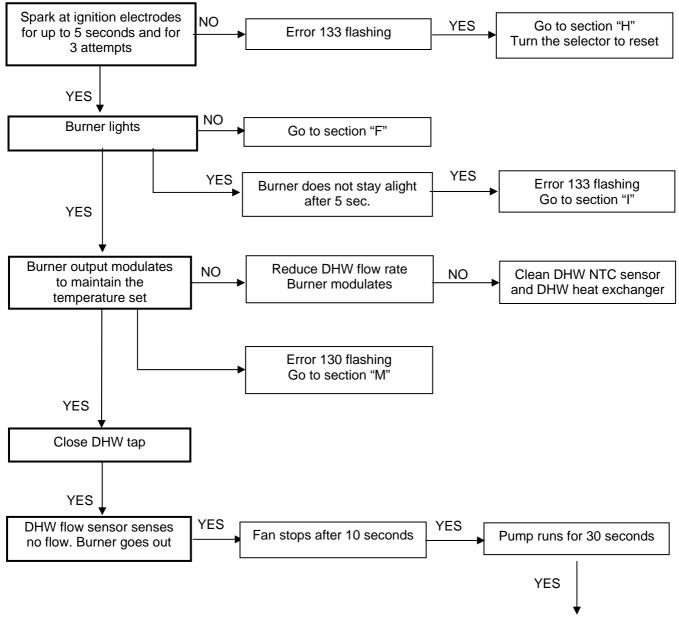

Operation sequence successful

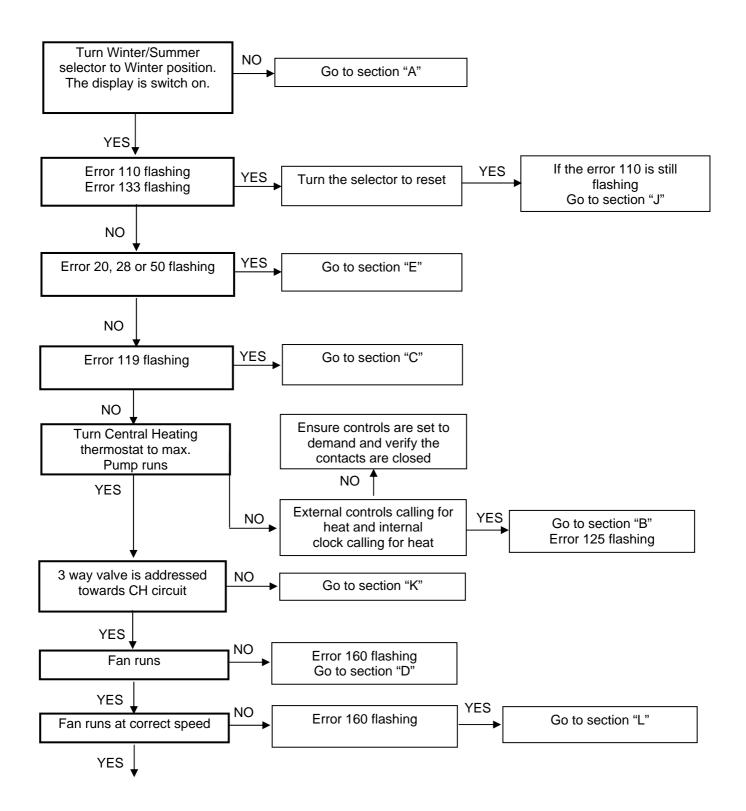



CENTRAL HEATING - Follow operational sequence – (continue)

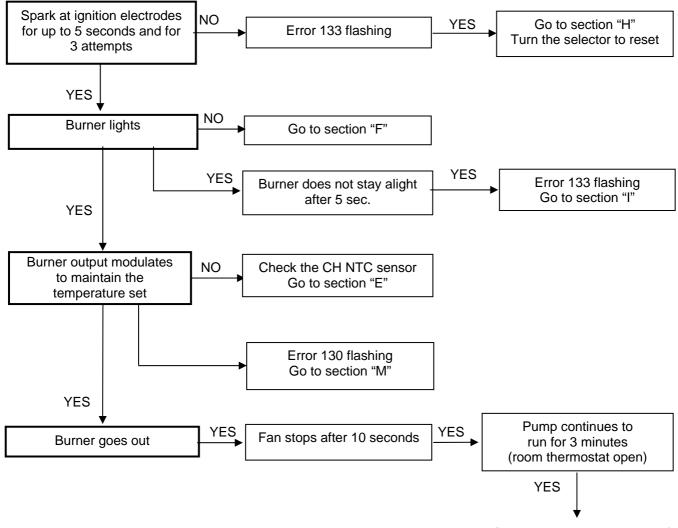


Operation sequence successful

FAULT FINDING SOLUTION SECTIONS

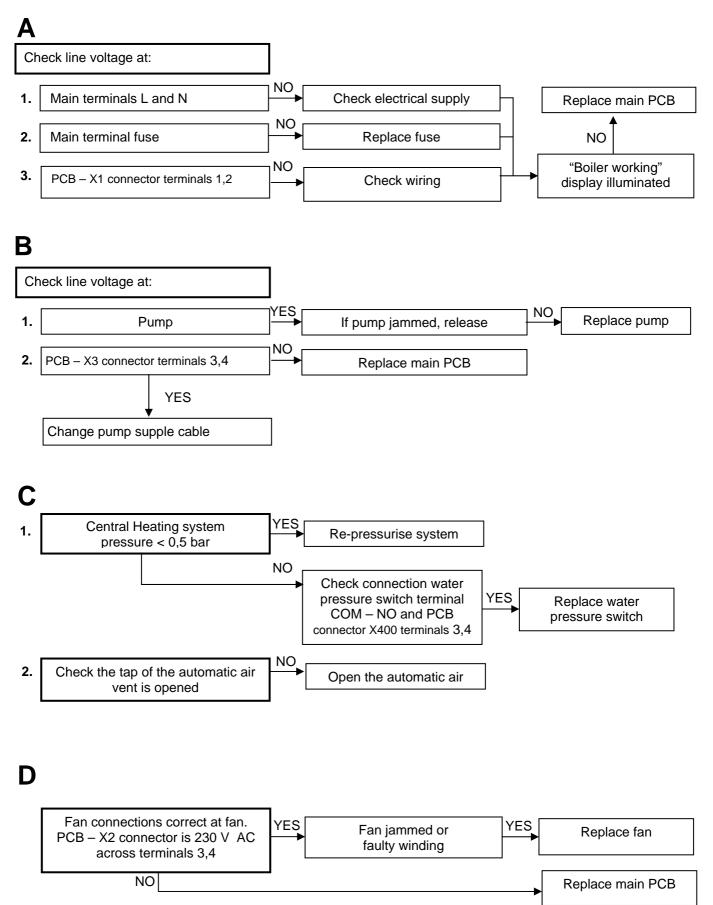

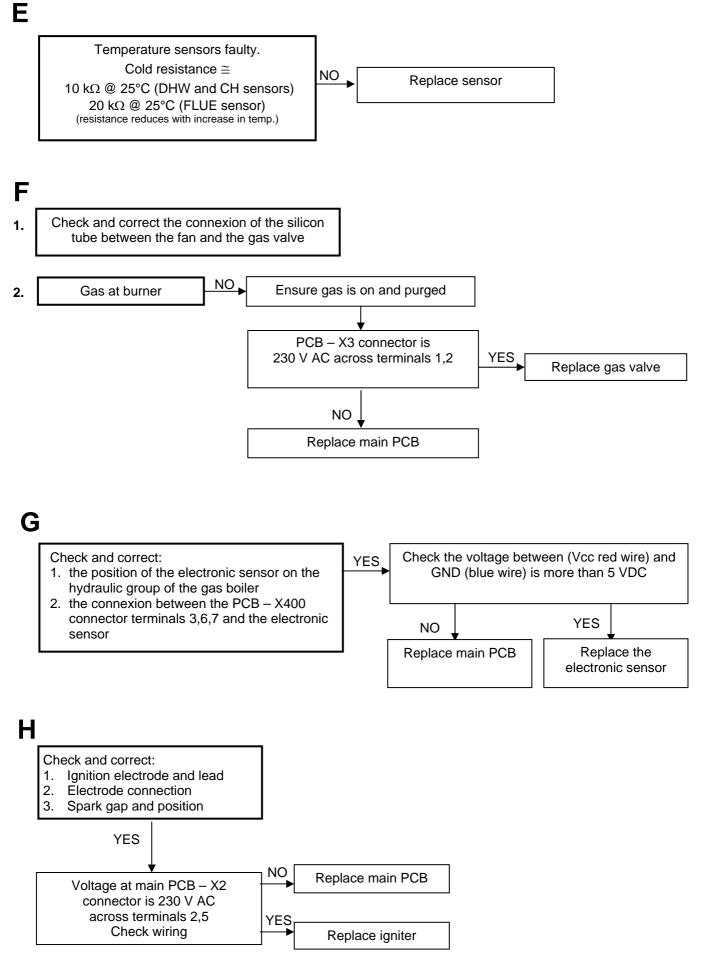

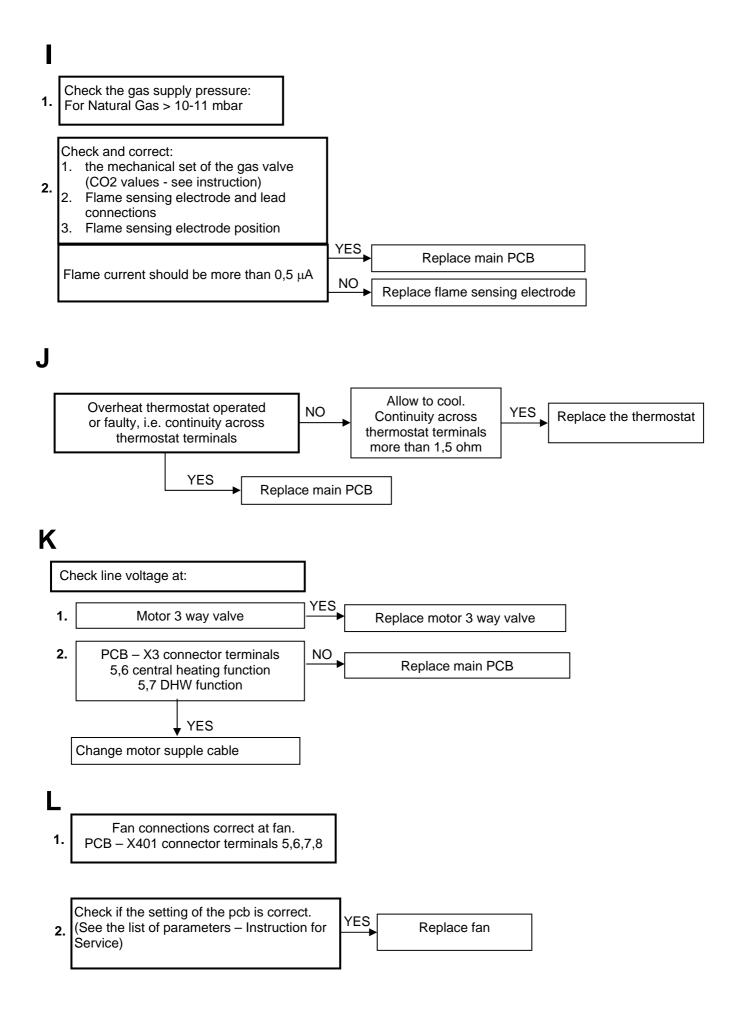

Μ

1.	Temperature sensors faulty. Cold resistance \cong 10 k Ω @ 25°C (CH sensor) 20 k Ω @ 25°C (FLUE sensor) (resistance reduces with increase in temp.)	NO Replace sensor
2.	If pump is running the exchanger could be obstructed	YES Replace exchanger